

International Aero Engines

INFORMATION BULLETIN

STANDARD PRACTICES - ENGINE - INFORMATION - ENGINE - TURBINE EXHAUST CASE ASSEMBLY - PROVIDE BUSHINGS AND BOLTS TO REPLACE THE PARTS PREVIOUSLY AVAILABLE FROM THE ORIGINAL MANUFACTURER OF THE TURBINE EXHAUST CASE ASSEMBLY - FIO - MOD.ENG-70-0565

1. Planning Information

A. Effectivity

(1) Aircraft: Airbus A320

(2) Engine: V2500-A1 Engines

B. Reason

To announce the availability of newly released repair parts.

C. <u>Compliance</u>

For information only.

D. Approval

The part numbr transactions shown under the Material Information portion of this Bulletin have been shown to comply with the applicable Federal Aviation Regulations and are FAA-APPROVED for the Engine Model listed.

E. References

(1) Internal Reference No.

91VA037M

(2) Other References

The V2500 Engine Manual (E-V2500-1IA).

F. General Information

The existing Repair Schemes given in the V2500 Engine Manual (E-V2500-1IA) will be revised to include the new Special Spare Parts that are now necessary for accomplishment.

ATA Ref. No. Repair Schemes Title

72-50-53 VRS 5393 Replace The Damaged Mount Bushes In The Turbine Exhaust

Case, Repair 009

V2500-ENG-70-0565

Printed in Great Britain

International Aero Engines

INFORMATION BULLETIN


72-50-53 VRS 5394

Replace The Damaged Ground Handling Bushes In The Turbine Exhaust Case, Repair 010

G. <u>Material Information</u>

New Part No. (ATA No.)	Qty	st'd nit rice (\$)	Keyword	Old Part No. (IPC No.)	Instructions Disposition
2A2163	4	00.80	Bushing, Sleeve	4P8118	(1) (A) (B)
(72-50-53)				(02-483)	(0) (1)
2A2163P5	A/R	00.80	Bushing, Sleeve	4P8118C01	(2) (A) (C)
(72-50-53)	A /D	00.00	D 1: 01	(02-484)	(2) (4) (0)
2A2163P10	A/R	00.80	Bushing, Sleeve	4P8118C02	(2) (A) (C)
(72-50-53) 2A2163P15	A /D	08.00	Duching Classes	(02-485) 4P8118C03	(2) (A) (C)
(72-50-53)	A/R	00.00	Bushing, Sleeve	(02-486)	(Z) (A) (C)
2A2163P20	A/R	08.00	Bushing, Sleeve	4P8118C04	(2) (A) (C)
(72-50-53)	A/ N	00.00	busining, steeve	(02-487)	(Z) (A) (C)
2A2163P25	A/R	08.00	Bushing, Sleeve	4P8118C05	(2) (A) (C)
(72-50-53)	717 11	00100	iiibasii iiigy occore	(02-488)	(2) (//) (0)
2A2161	6	08.00	Bushing, Sleeve	4P8117	(1) (A) (B)
(72-50-53)			,	(02-493)	
2A2161P5	A/R	08.00	Bushing, Sleeve	4P8117C01	(2) (A) (C)
(72-50-53)			σ,	(02-494)	
2A2161P10	A/R	00.80	Bushing, Sleeve	4P8117C02	(2) (A) (B)
(72-50-53)				(02-495)	
2A2161P15	A/R	08.00	Bushing, Sleeve	4P8117C03	(2) (A) (C)
(72-50-53)				(02-496)	
2A2161P20	A/R	00.80	Bushing, Sleeve	4P8117C04	(2) (A) (C)
(72-50-53)				(02-497)	
2A2161P25	A/R	00.80	Bushing, Sleeve	4P8117C05	(2) (A) (C)
(72-50-53)	_			(02-498)	
MS9575-04	2	20.30	.Bolt	AS43706	(1) (A) (C)
(73-22-51)	2	20. 70	B 11	(01-060)	(4) (4) (0)
MS9575-04	2	20.30	.Bolt	AS43706	(1) (A) (C)
(73-22-51) MS9575-04	2	20.30	.Bolt	(01-190) AS43706	(1) (A) (C)
(73-22-51)	۷	20.30	. DULL	(01-320)	(I) (A) (C)
MS9575-04	8	20.30	.Bolt	AS43706	(1) (A) (C)
(73-22-51)	O	20.30	. 50 € €	(01-120)	(1) (A) (C)
(IJ LL JI)				(01 120)	

V2500-ENG-70-0565

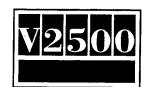

International Aero Engines

INFORMATION BULLETIN

H. <u>Instruction/Disposition Code Statements:</u>

- (1) Old and new parts are freely and fully interchangeable.
- (2) Old and new parts are freely and fully interchangeable, however, the correct oversize must be selected to accomplish the repair (VRS 5393 and 5394).
- (A) New part is currently available.
- (B) The old part will no longer be supplied.
- (C) The old part will continue to be supplied until stock is depleted.

NOTE: The estimated 1997 unit prices shown are provided for planning purposes only and do not constitute a firm quotation. Consult the IAE Price Catalog or contact IAE's Spare Parts Sales Department for information concerning firm prices.

