

**International Aero Engines****RR-DERBY**

400 MAIN STREET, MAIL STOP 121-10
EAST HARTFORD, CT 06108, USA.
TELEPHONE: 860 565 5515
FAX: 860 565 0600

DATE: **Nov.30/01**

P.O. BOX 31, DERBY
TELEGRAMS - 'ROYCAR' DERBY
TELEX - 37645
TELEPHONE - DERBY 242424

V2500-A1/A5/D5 PROPULSION SYSTEM SERVICE BULLETIN

Printed in Great Britain

This document transmits the Initial Issue of Service Bulletin EV2500-70-0784

Bulletin Initial Issue

Remove

Incorporate
Pages 1 to 6 of the
Service Bulletin

Reason for change
Initial issue

V2500-ENG-70-0784

Transmittal - Page 1 of 2

CHECK THAT ALL PREVIOUS TRANSMITTALS HAVE BEEN INCORPORATED

If any have not been received please advise Publication Services, Rolls-Royce plc, Derby, England

© Rolls-Royce plc (date as above) Printed in Great Britain

LIST OF EFFECTIVE PAGES

The effective pages to this Service Bulletin are as follows:

<u>Page</u>	<u>Revision Number</u>	<u>Revision Date</u>
-------------	------------------------	----------------------

Bulletin		
----------	--	--

1		Nov.30/01
2		Nov.30/01
3		Nov.30/01
4		Nov.30/01
5		Nov.30/01
6		Nov.30/01

Printed in Great Britain

V2500-ENG-70-0784
Transmittal - Page 2



V2500-ENG-70-0784 ENGINE - OIL PART NUMBER CORRECTION

1. Planning Information

A. Effectivity

- (1) Airbus A319
V2522-A5, V2524-A5, V2527M-A5 Engines
- (2) Airbus A320
 - (a) V2500-A1, Engines
 - (b) V252E-A5, V2527-A5 Engines
- (3) Airbus A321
V2530-A5, V2533-A5 Engines
- (4) Boeing - Longbeach Division MD-90
V2525-D5, V2528-D5 Engines
- (5) ATA Location
79-22-48

B. Concurrent Requirements

None

C. Reason

To change an incorrect part number. To move some parts from the actual position (fig. item) to a new position, See Fig. 1 sheet 1. To correct the quantity of some items. See Fig. 1 sheet 2.

D. Compliance

Category Code 7

Accomplish when supply of superseded parts has been depleted.

E. Approval

The part number changes and/or part modification described in Section 2 and 3 of this Modification Bulletin have been shown to comply with the applicable Federal Aviation Regulations and are FAA approved for the Engine Models Listed.

Nov.30/01
Nov.30/01

V2500-ENG-70-0784

Page 1 of 6

© Rolls-Royce plc

Not subject to the EAR per 15 C.F.R. Chapter 1, Part 734.3(b)(3).



F. References

- (1) IAE Engineering Change Number 99VF009
- (2) The V2500 Engine Illustrated Parts Catalog, 79-22-48

G. Other Publications Affected

- (1) The V2500 Engine Illustrated Parts Catalog, 79-22-48 will be revised to show the new part numbers and ATA positions

**2. Material Information****A. Kits associated with this Bulletin:**

None

B. Parts affected by this Bulletin:

For V2500-A1, V2522-A5, V2524-A5, V2527-A5, V2527E-A5, V2527M-A5, V2530-A5 Engines

79-22-48

FIG ITEM NO.	NEW PART NO.	QTY	PART TITLE	MAT	OLD PART NO.	INSTR DISP
04145	MS21919 WF12	1	.Clamp	-	MS21919F12	(A) (S1)
04160	MS21919 WF12	1	.Clamp	-	MS21919F12	(A) (S1)

For V2525-D5, V2528-D5 Engines

79-22-48

FIG ITEM NO.	NEW PART NO.	QTY	PART TITLE	MAT	OLD PART NO.	INSTR DISP
02120	AS41104	1	.Nut, A/O Self Locking	-	AS41104	(A) (S1) (1D)
02122	MS9321-09	1	.Washer, Flat	-	MS9321-09	(A) (S1) (1D)
02124	4W0104	1	.Bolt	-	4W0104	(A) (S1) (1D)
02126	MS21919 WF12	1	.Clamp	-	MS21919F12	(A) (S1) (1D)
02152	4W0104	1	.Bolt	-	4W0104	(A) (S1) (1D)
02154	MS9321-09	1	.Washer, Flat	-	MS9321-09	(A) (S1) (1D)
02156	AS41104	1	.Nut, A/O Self Locking .190 DIA	-	AS41104	(A) (S1) (1D)

Nov.30/01

Nov.30/01

V2500-ENG-70-0784

Page 3



FIG ITEM NO.	NEW PART NO.	QTY	PART TITLE	MAT	OLD PART NO.	INSTR DISP
02158	MS21919 WF12	1	.Clamp	-	MS21919F12	(A) (S1) (1D)
04135	4W0104	1	.Bolt	-	4W0104	(A) (S1) (1D)
04137	MS9321-09	1	.Washer, Flat	-	MS9321-09	(A) (S1) (1D)
04140	AS41104	1	.Nut, A/O Self Locking	-	AS41104	(A) (S1) (1D)
04145	MS21919 WF12	1	.Clamp	-	MS21919F12	(A) (S1) (1D)
04150	4W0104	1	.Bolt	-	-	(A)
04152	MS9321-09	1	.Washer, Flat	-	-	(A)
04155	AS41104	1	.Nut, A/O Self Locking .190 DIA	-	-	(A)
04160	MS21919 WF12	1	.Clamp	-	-	(A)

C. Instructions disposition codes:

(A) New part is currently available.

(S1) Old and new parts coded (S1) are fully interchangeable

(1D) Quantity of Part Number decreased from 2 to 1

3. Accomplishment Instructions

None



CHANGE FIG. ITEM AND QTY
FROM 04-145, QTY 2
TO 04-160, QTY 1

CHANGE FIG. ITEM AND QTY
FROM 04-137 QTY 2
TO 04-152 QTY 1

CHANGE FIG. ITEM AND QTY
FROM 04-135 QTY 2
TO 04-150 QTY 1

CHANGE QTY
FROM 04-135 QTY 2
TO 04-135 QTY 1

CHANGE QTY
FROM 04-137 QTY 2
TO 04-145, QTY 1

SCAVENGE OIL TUBE

CHANGE QTY
FROM 04-145 QTY 2
TO 04-145 QTY 1


CHANGE FIG. ITEM AND QTY
FROM 04-140 QTY 2
TO 04-155 QTY 1

CHANGE QTY
FROM 04-140 QTY 2
TO 04-140 QTY 1

ff00sb0006

All IPC Fig/Item numbers are 79-22-48

Oil scavenge tube
Fig 1 sheet 1

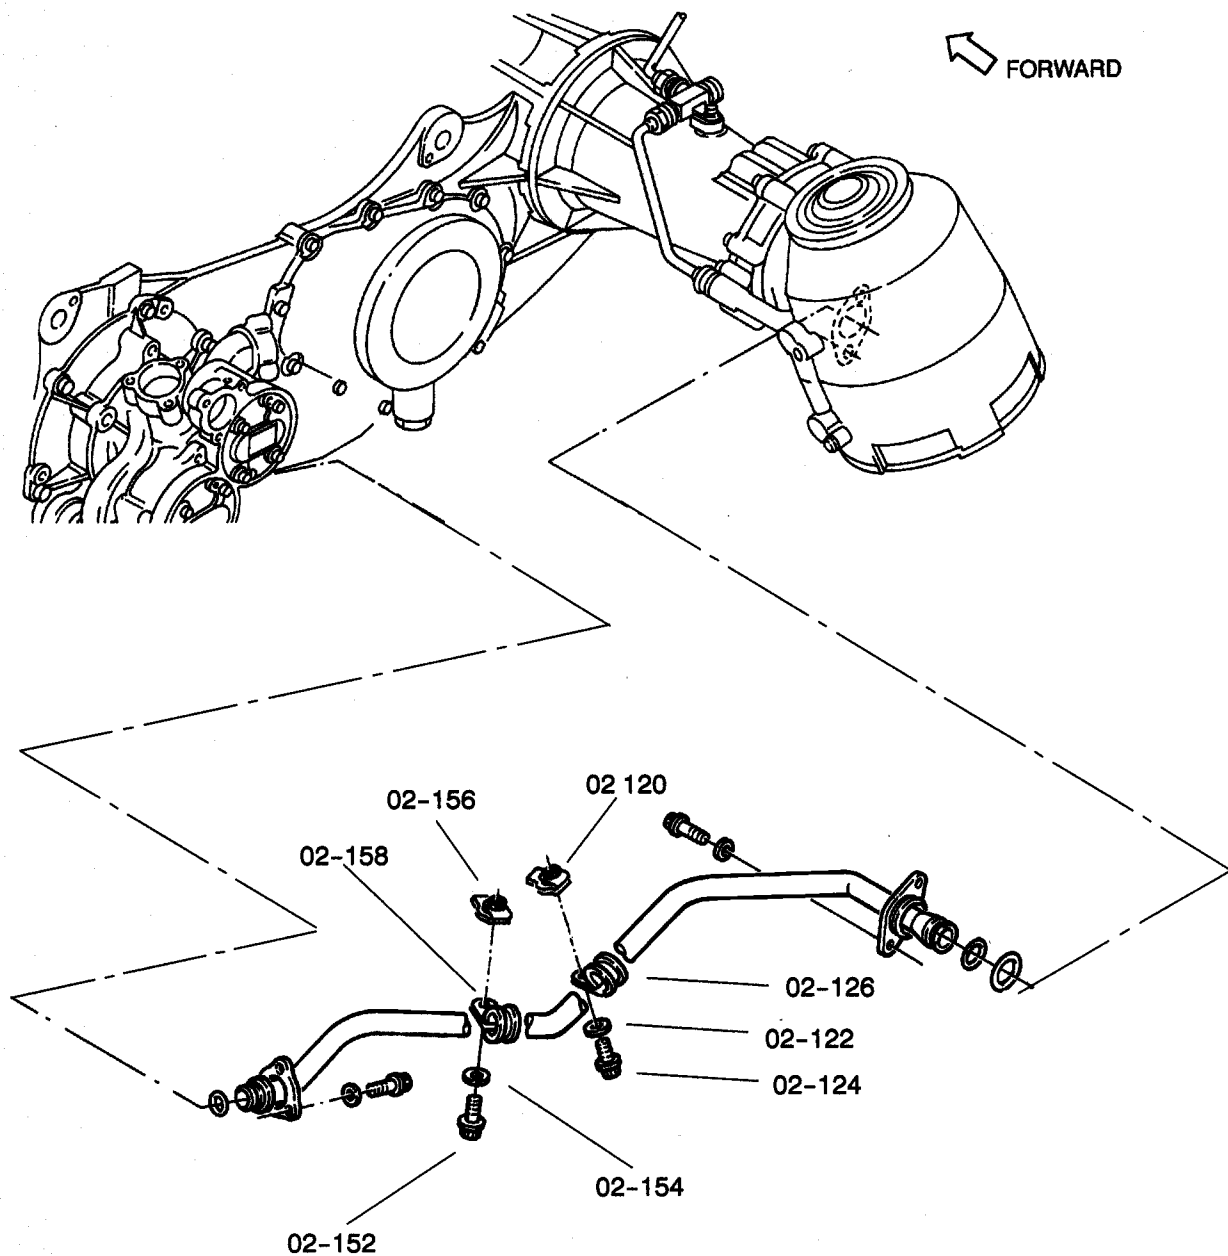

THE FIG ITEM LISTED CHANGE QUANTITY FROM 2 TO 1

7100sb0007

All IPC Fig/Item numbers are 79-22-48

Oil scavenge tube
Fig 1 sheet 2

Nov.30/01
Nov.30/01

V2500-ENG-70-0784

Page 6

© Rolls-Royce plc

Not subject to the EAR per 15 C.F.R. Chapter 1, Part 734.3(b)(3).