



STANDARD PRACTICES - ENGINE - INFORMATION - ENGINE - DIFFUSER AND COMBUSTION SECTION -
PERMIT THE USE OF ADDITIONAL COMBUSTION CHAMBER CLAMP SPACERS - CATEGORY CODE 8 -
MOD.ENG-70-0255

1. Planning Information

A. Effectivity

- (1) Aircraft: Airbus A320, A321 and McDonnell Douglas MD-90
- (2) Engine: V2500-A1 Engines before Serial No. V0280
V2500-A5 Engines before Serial No. V10010
V2500-D5 Engines before Serial No. V20007

B. Reason

To make sure there is a correct fit between the Stage 1 HPT Seal (Bellyband) and the Outer Combustion Chamber. This is done by the use of additional Combustion Chamber Clamp Spacers.

C. Compliance

Category Code 8

Accomplish based upon experience with the prior configuration.

D. Approval

The part number transactions shown under the Material Information portion of this Bulletin have been shown to comply with the applicable Federal Aviation Regulations and are FAA-APPROVED for the Engine Model listed.

E. References

- (1) Internal Reference No.


92VA147

92VA147A

F. General Information

- (1) The Material Information portion of this Bulletin provides the latest information concerning the availability of Combustion Chamber Clamp Spacers.


V2500-ENG-70-0255

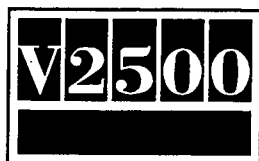G. Material Information

New Part No. (ATA No.)	Qty	Est'd Unit Price (\$)	Keyword	Old Part No. (IPC No.)	Instructions Disposition
2A0354 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354 (02-060)	(A) (B)
2A0354CL1 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL1 (02-061)	(A) (B)
2A0354CL2 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL2 (02-062)	(A) (B)
2A0354CL3 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL3 (02-063)	(A) (B)
2A0354CL4 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL4 (02-064)	(A) (B)
2A0354CL5 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL5 (02-065)	(A) (B)
2A0354CL6 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL6 (02-066)	(A) (B)
2A0354CL7 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL7 (02-067)	(A) (B)
2A0354CL8 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL8 (02-068)	(A) (B)
2A0354CL9 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL9 (02-069)	(A) (B)
2A0354CL10 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL10 (02-070)	(A) (B)
2A0354CL11 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL11 (02-071)	(A) (B)
2A0354CL12 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL12 (02-072)	(A) (B)
2A0354CL13 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL13 (02-073)	(A) (B)
2A0354CL14 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL14 (02-074)	(A) (B)
2A0354CL15 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL15 (02-075)	(A) (B)
2A0354CL16 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL16 (02-076)	(A) (B)
2A0354CL17 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL17 (02-077)	(A) (B)
2A0354CL18 (72-40-00)	A/R	37.80	Spacer, Combustion Chamber Clamp	2A0354CL18 (02-078)	(A) (B)

Printed in Great Britain

V2500-ENG-70-0255

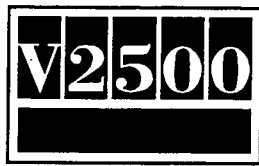

H. Instruction/Disposition Code Statements:

- (A) The new part and the old part are the same. The new part will continue to be supplied.
- (B) Quantity is increased from one, to, as required.

NOTE: The estimated 1993 unit prices shown are provided for planning purposes only and do not constitute a firm quotation. Consult the IAE Price Catalog or contact IAE's Spare Parts Sales Department for information concerning firm prices.

