

STANDARD PRACTICES - ENGINE - INFORMATION - ENGINE - TO ANNOUNCE THE AVAILABILITY OF
REVISED MATERIAL LP COMPRESSOR BLEED ACTUATOR MOUNTING BRACKETS - CATEGORY CODE 7 -
MOD.ENG-70-0272

1. Planning Information

A. Effectivity

- (1) Aircraft : Airbus A320
(2) Engine : V2500-A1

B. Reason

To announce the availability of a more durable standard of LP Compressor Bleed Actuator Mounting Bracket.

C. Compliance

Category Code 7

Accomplish when supply of superseded parts has been depleted.

D. Approval

The part numbers shown in the MATERIAL INFORMATION portion of this Service Bulletin have been shown to comply with the applicable Federal Aviation Regulations and are FAA-APPROVED for the Engine Model listed.

E. References

- (1) Internal Reference No.
EC92VR117


F. General Information

The Material Information portion of this Bulletin provides the latest information concerning the availability of the revised material brackets.

G. Material Information

New Part No. (ATA No.)	Qty	Est'd Unit Price (\$)	Keyword	Old Part No. (IPC No.)	Supply Status
6A4652 (75-31-42)	1	64.70	Bracket assy, support	6A2168 (01-180)	(A)(B) (1)

V2500-ENG-70-0272

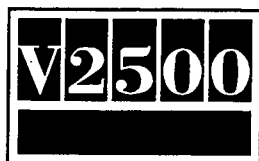

International Aero Engines
INFORMATION BULLETIN

Printed in Great Britain

- (75-31-42)	1		Bracket assy, mounting	5A0347 (01-200)	(B)(1)
- (75-31-42)	4		Bolt	AS43326 (01-210)	(C)(1)
- (75-31-42)	4		Insert, screw thread	AGS3782 (01-230)	(C)(D) (1)
- (75-31-42)	1		Guide	5A0334 (01-250)	(B)(1)
- (75-31-42)	1		Nut	4W0043 (01-263)	(C)(1)
- (75-31-42)	1		Bolt	AS20909 (01-265)	(C)(1)
- (75-31-42)	1		Washer	4W2621 (01-267)	(C)(1)
6A5478 (75-31-42)	1	2606.00	Bracket assy, mounting	- (01-400)	(A)(1)
AS43316 (75-31-42)	2	10.40	Bolt	- (01-410)	(A)(1)
AS43317 (75-31-42)	2	10.80	Bolt	- (01-411)	(A)(1)
AS52761 (75-31-42)	2	13.40	Insert, screw thread	- (01-438)	(A)(E) (1)
AS44806 (75-31-42)	1	10.20	Pin, shoulder	- (01-440)	(A)(E) (1)
AS21017 (75-31-43)	2	3.40	Bolt, bi-hex	4W0171 (01-112)	(A)(C) (2)
- (75-31-43)	1		Bracket assy, mounting	5A0348 (01-200)	(B)(2)
- (75-31-43)	4		Bolt, bi-hex	AS43326 (01-210)	(C)(2)
- (75-31-43)	1		Insert, screw thread	AGS3782 (01-230)	(C)(F) (2)
- (75-31-43)	1		Guide	5A0335 (01-250)	(B)(2)

V2500-ENG-70-0272



International Aero Engines
INFORMATION BULLETIN

Printed in Great Britain

- (75-31-43)	1		Nut	4W0043 (01-263)	(C)(2)
- (75-31-43)	1		Bolt, bi-hex	AS20909 (01-265)	(C)(2)
- (75-31-43)	1		Washer	4W2621 (01-267)	(C)(2)
6A5479 (75-31-43)	1	2628.00	Bracket assy, mounting	- (01-400)	(A)(2)
AS43316 (75-31-43)	4	10.40	Bolt, bi-hex	- (01-410)	(A)(2)
AS52761 (75-31-43)	3	13.40	Insert, screw thread	- (01-438)	(A)(G) (2)
AS44806 (75-31-43)	1	10.20	Pin, shoulder	- (01-440)	(A)(G) (2)

H. Supply Status Code Statements

- (A) New part is currently available
- (B) Old part is no longer available
- (C) Old part may be used up in other applications
- (D) Detail of 5A0347
- (E) Detail of 6A5478
- (F) Detail of 5A0348
- (G) Detail of 6A5479
- (1) Old and new parts coded (1) must be used in a COMPLETE SET
- (2) Old and new parts coded (2) must be used in a COMPLETE SET

NOTE: The estimated 1995 unit price shown is provided for planning purposes only and does not constitute a firm quotation. Consult the IAE Price Catalog or contact IAE's Spare Parts Sales Department for information concerning firm prices.

V2500-ENG-70-0272

Jul.7/95

Page 3

